
SERVICE BULLETIN

Original Issue Date: **8/95**
Model: **20-180ROZJ**
Market: **Industrial**
Subject: **Overcharging Batteries In Prime Power Applications**

Kohler Generator Division has received reports of battery overcharging on 20-180ROZJ generator sets used in prime power applications. For generators operating in prime power applications the high voltage of the John Deere engine alternator may overheat the battery. Overheating the battery leads to boil off and premature battery failure.

There is a service kit (part number 336674 20-60 kW, 336690 80-180 kW) to correct battery overcharging. The service kit includes instructions (TT-1098) for installation, three leads, resistor, and a diode.

In applications where battery overcharging is occurring due to the John Deere battery charging alternator contact your Service Parts Department to order this kit.

| Routing | Service Manager | Sales Manager | Parts Manager | Technician No. 1 | Technician No. 2 | Technician No. 3 | Return This to |
|--------------|-----------------|---------------|---------------|------------------|------------------|------------------|----------------|
| Initial Here | | | | | | | |