

GE ZENITH Controls

Replace the Solenoid, Rectifier & Disconnect Switch Block for a 1600 to 3000 Amp ZBTS Bypass Switch

Purpose:	To replace a defective Solenoid, Rectifier Disconnect Switch Block.
When:	When directed by a service order.

Required Tools & Equipment:

Basic electricians hand tools	PPE
Multimeter Digital or Analog	Rubber insulating gloves class 0
Solenoid	Safety glasses
Tie wraps	Electrical hazard safety shoes
Contact Block for Disconnect Switch	
Rectifier Assembly	



Danger

HAZARDOUS VOLTAGE
Can Cause Severe Injury or Death

Ensure that the load is shifted to the bypass before working on the ATS power panel.

Do These Steps:

1. *Obtain* the proper documentation.
2. *Bypass* the ATS.
 - 1) *Open* the bottom cabinet door.
 - 2) *Place* the Disconnect Switch (DS) to "Inhibit".
 - 3) *Turn* the Bypass Selector Switch (BSS) to the same power source as the ATS.
 - 4) *Move* the Manual Bypass Handle (MBH) upward.

Note: This will place the load onto the bypass section of the switch.

GE ZENITH Controls

3. *Isolate* the ATS

- 1) Rotate the crank mechanism counterclockwise until the ATS Isolate light is illuminated.

Note: The ATS location pointer will also indicate when the ATS is isolated.

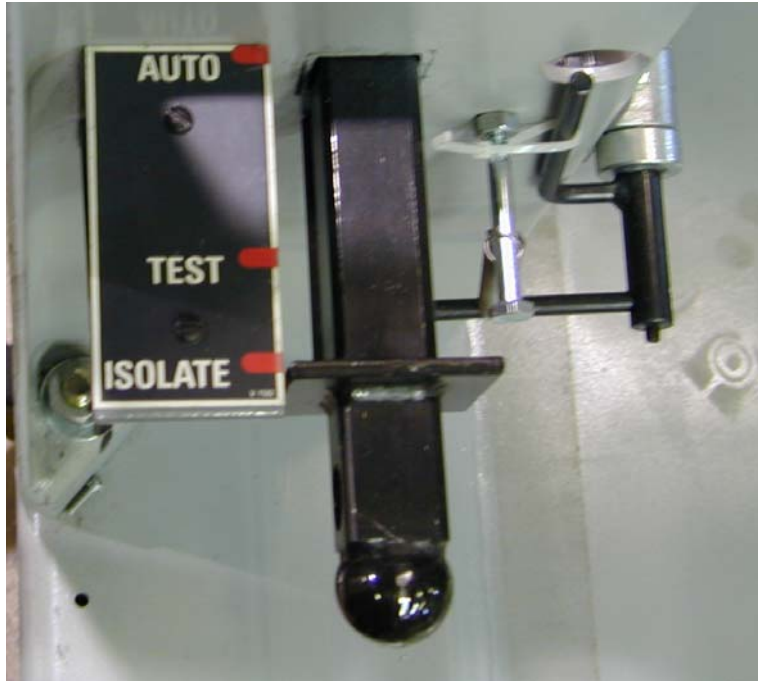


Figure 1.

4. Remove the ATS.

- 1) Disconnect the multi-pin plugs from the ATS.
 - 2) Disconnect the external connections to the ATS.
 - 3) Place the ATS movement ramps.
 - 4) Slide the four (4) corner latches of the ATS to the innermost position.
 - 5) Remove the ATS from the bypass cabinet.
5. Close the cabinet door.

GE ZENITH Controls

6. Remove the solenoid operator cover.

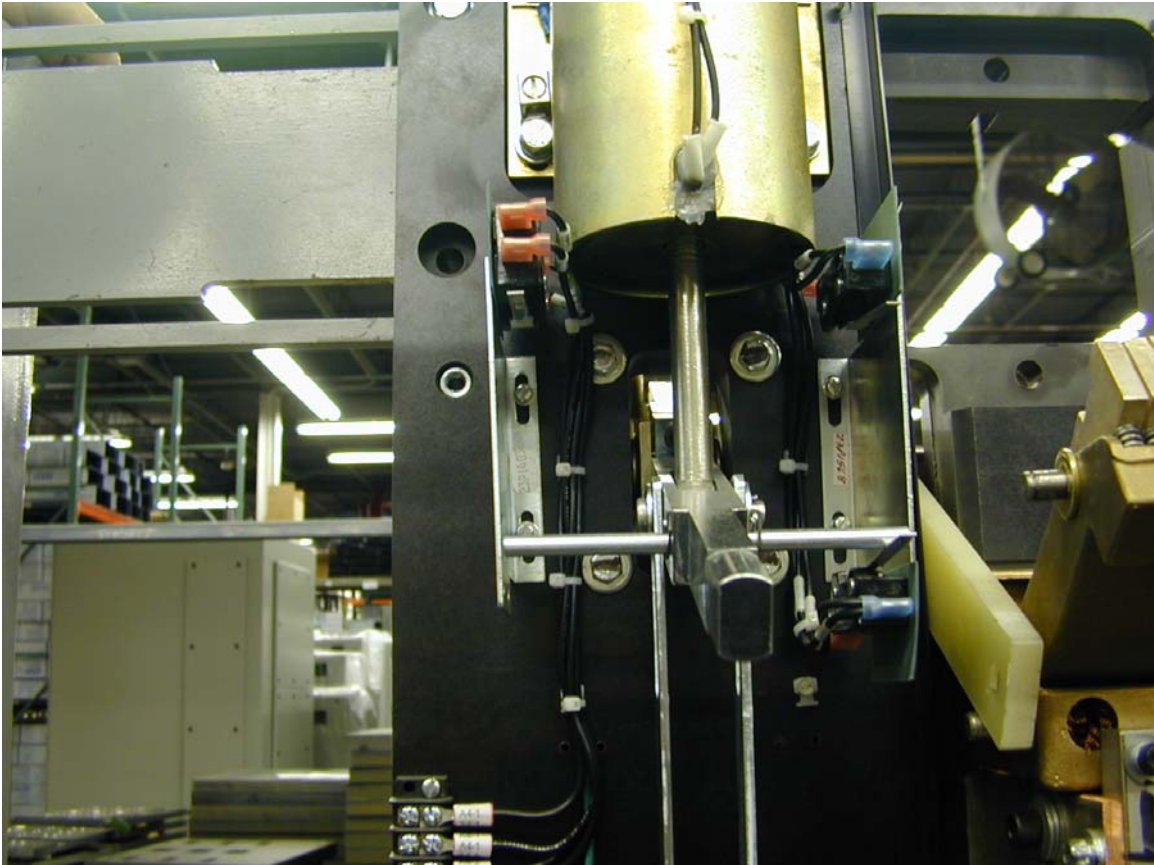


Figure 2.

7. Determine the solenoid to remove.

Note: The steps for removal and replacement for both the upper and lower solenoids are the same.

GE ZENITH Controls

8. Remove the two (2) solenoid bolts that secure the bracket.

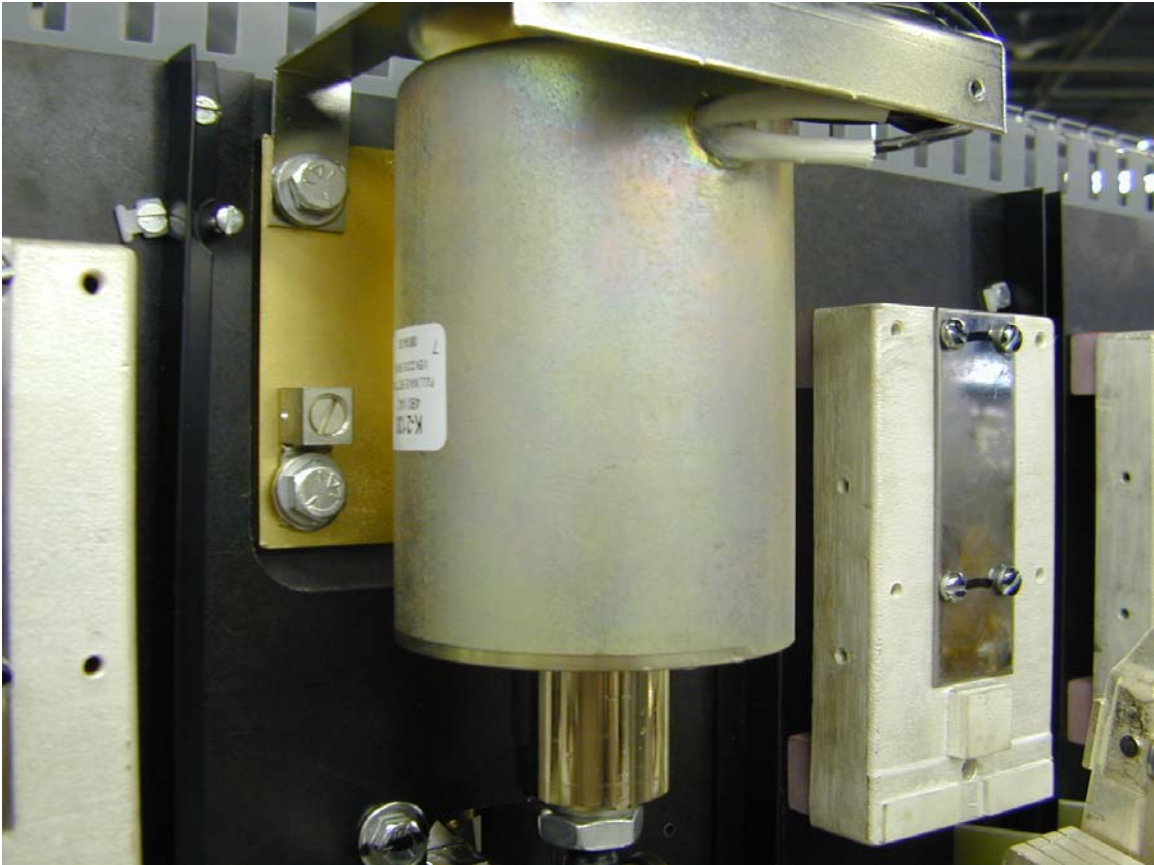


Figure 3.

9. Remove the lock nut holding the DS in place.

10. Remove the DS from the bracket.

11. Scribe the position of the solenoid.

Note: The scribe mark is used to return the solenoid to the manufacturing position.

12. Cut the harness tie wraps to the associated rectifier.

GE ZENITH Controls

13. Remove the cotter pin from the Clevis pin.

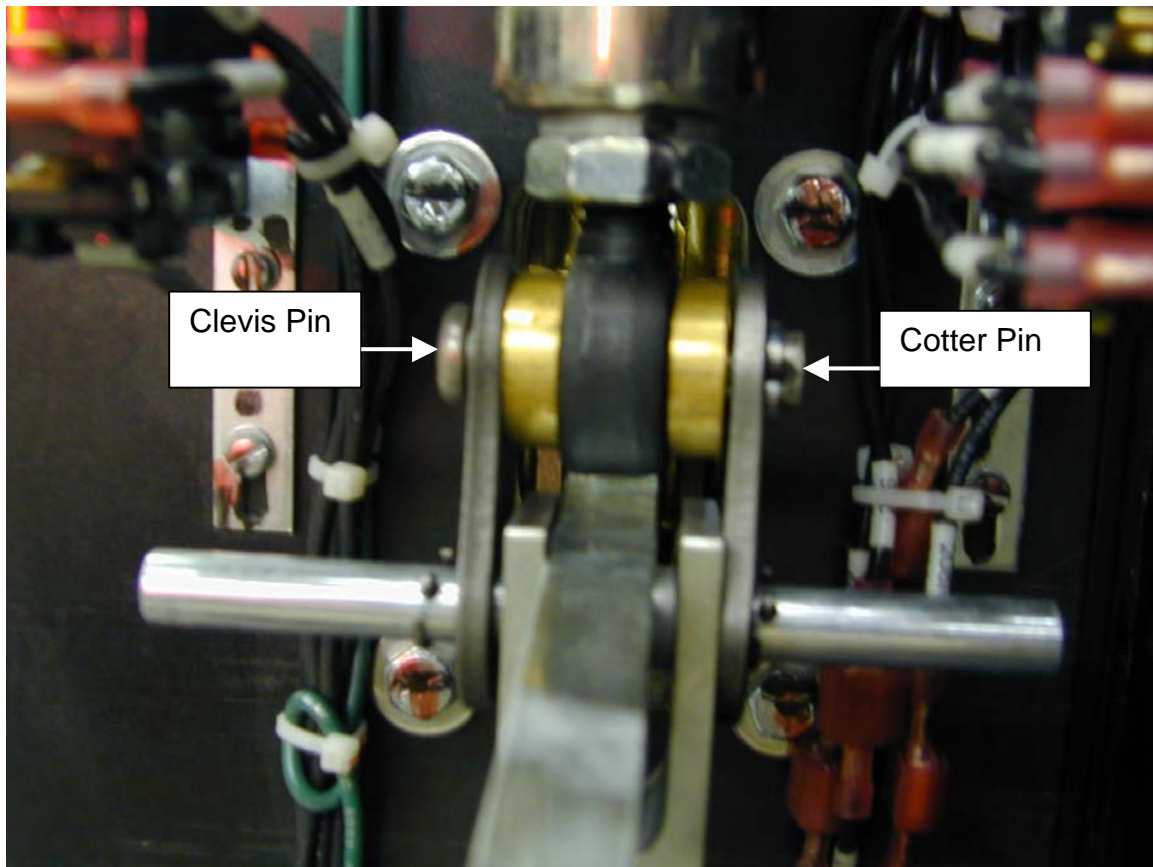


Figure 4.

14. Remove the Clevis pin to disconnect the plunger from the linkage.

15. Loosen the remaining two bolts holding the solenoid in place.

16. Disconnect the DC "Fast On" connections from the harness.

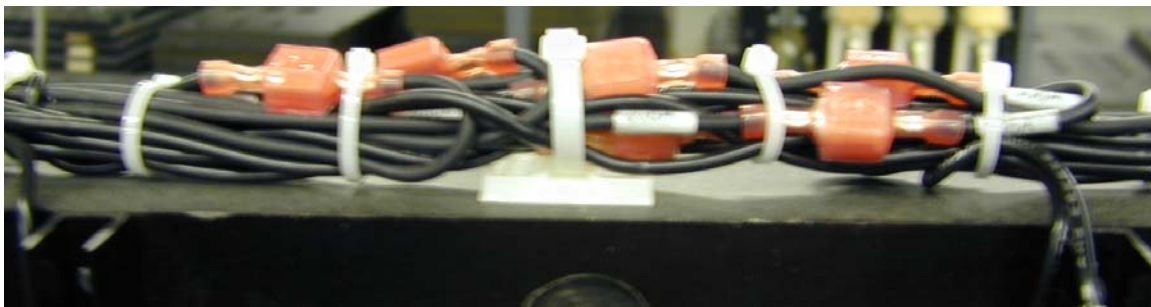


Figure 5.

17. Remove the final two bolts holding the solenoid.

18. Remove the solenoid from the ATS.

GE ZENITH Controls

19. Check the resistance to determine which coil in the solenoid is defective.

Note: If the reading is infinite or shorted, that coil is defective.

20. Remove the AC "Fast On" connections, from the harness, associated with the defective rectifier.

21. Remove the two screws holding the rectifier pack.

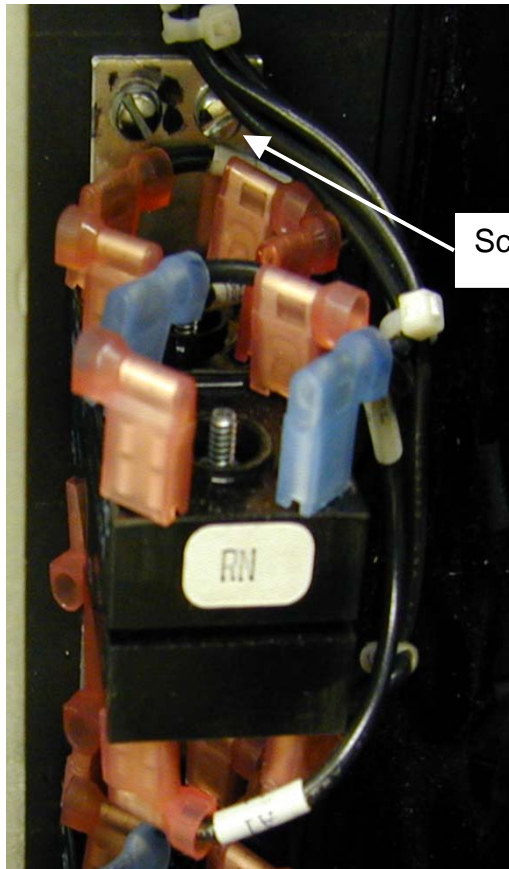


Figure 6. (old style)

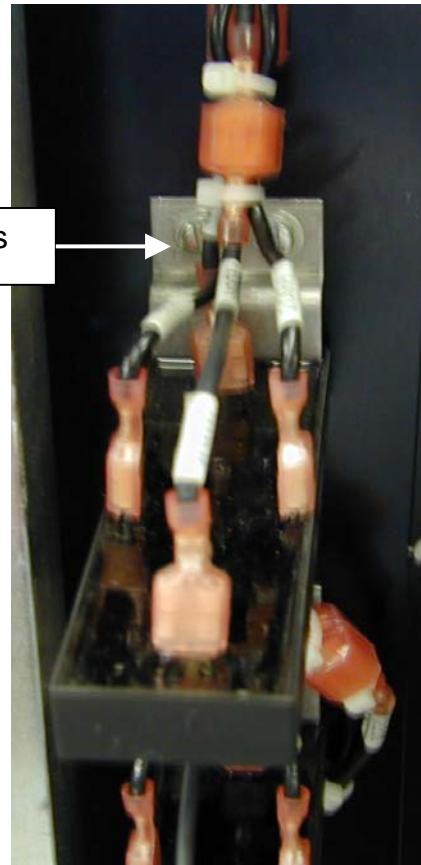


Figure 7. (new style)

22. Remove the rectifier pack.

GE ZENITH Controls

23. Remove the wiring from the associated block of the DS.

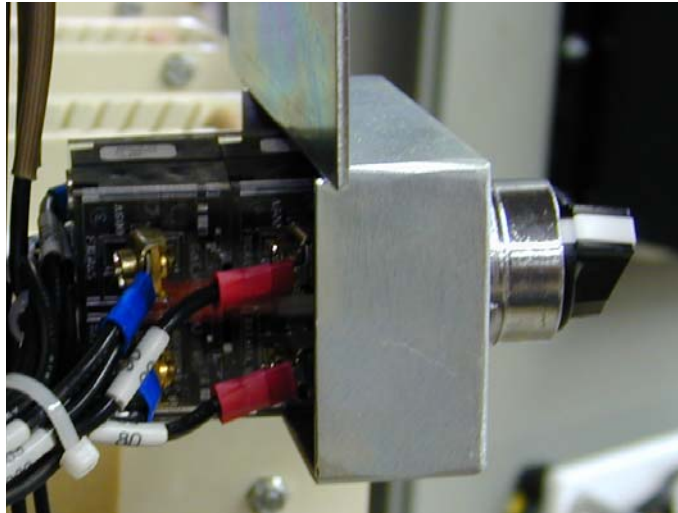


Figure 8.

24. Remove the associated block from the DS.

25. Examine the harness, associated with the defective coil, for burnt or charred insulation.

If the insulation is:	Then
Good	Continue on.
Burning/charring no more than two individual wires.	Repair wiring. Continue on.
Burning/charring of three or more wires.	Call for service tech to replace the harness.

26. Install the new block into the DS.

27. Connect the wiring to the new block of the DS.

GE ZENITH Controls

28. Install the new rectifier pack.

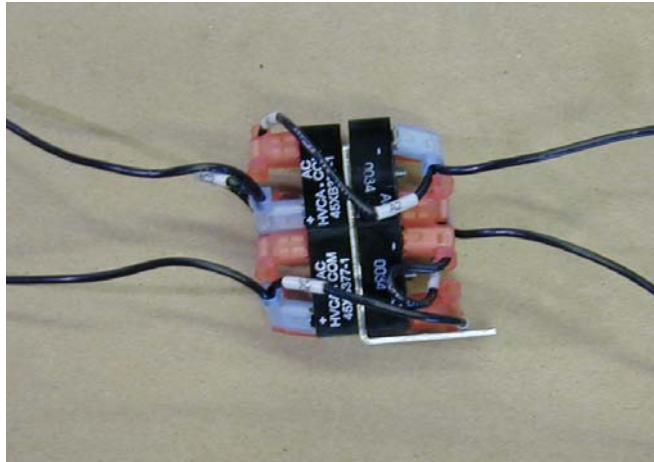


Figure 9.

29. Connect the rectifier pack AC “Fast On” connections to the wiring harness.

30. Install the solenoid.

31. Tighten the two (2), non bracket, bolts hand tight.

32. Adjust the solenoid to the scribed mark in step 11.

33. Torque the bolts to 25 ft-lbs.

34. Connect the DC “Fast On” connections in the wiring harness.

35. Align the plunger to the linkage.

GE ZENITH Controls

36. Insert the Clevis pin through the linkage and plunger.

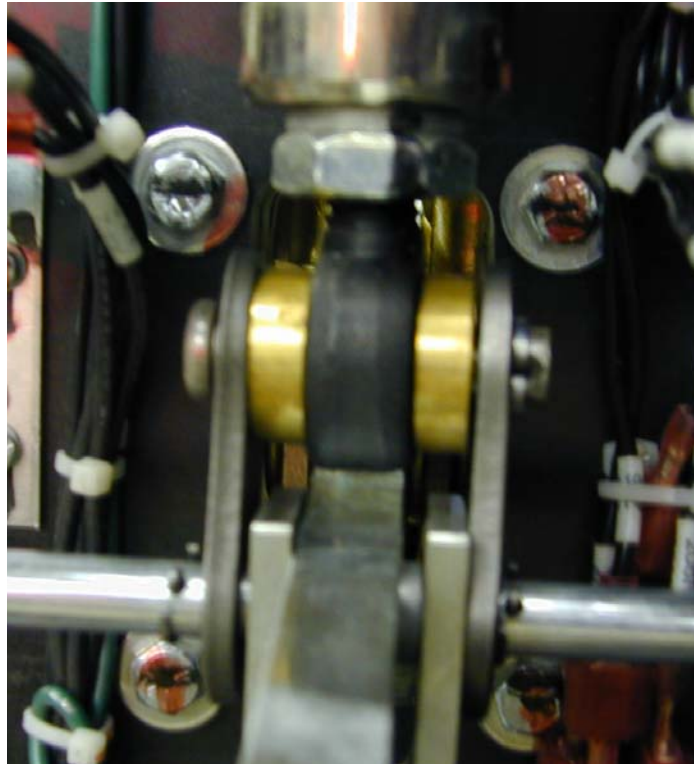


Figure 10.

37. Install the washers and cotter pin in to the Clevis pin.

38. Install the DS into the bracket.

39. Tighten the lock nut onto the DS.

40. Install the bracket.

41. Tighten the remaining two (2) solenoid bolts, hand tight.

42. Place the ATS into the normal position.

43. Check the Clevis pin for some free play.

Note: If you do not have some small amount of free play, adjust the solenoid up a few thousands upwards.

44. Place the ATS into the emergency position.

45. Check the Clevis pin for some free play.

Note: If you do not have some small amount of free play, adjust the solenoid up a few thousands downwards.

46. Repeat steps 42 and 45 until you have a few thousands play from the plunger in both normal and emergency.

GE ZENITH Controls

47. Adjust the Limit Switches.

- 1) Place solenoid into the Zero Toggle position.

Note: Zero toggle is obtained when the contact block in the rear of the panel is parallel to the ground.

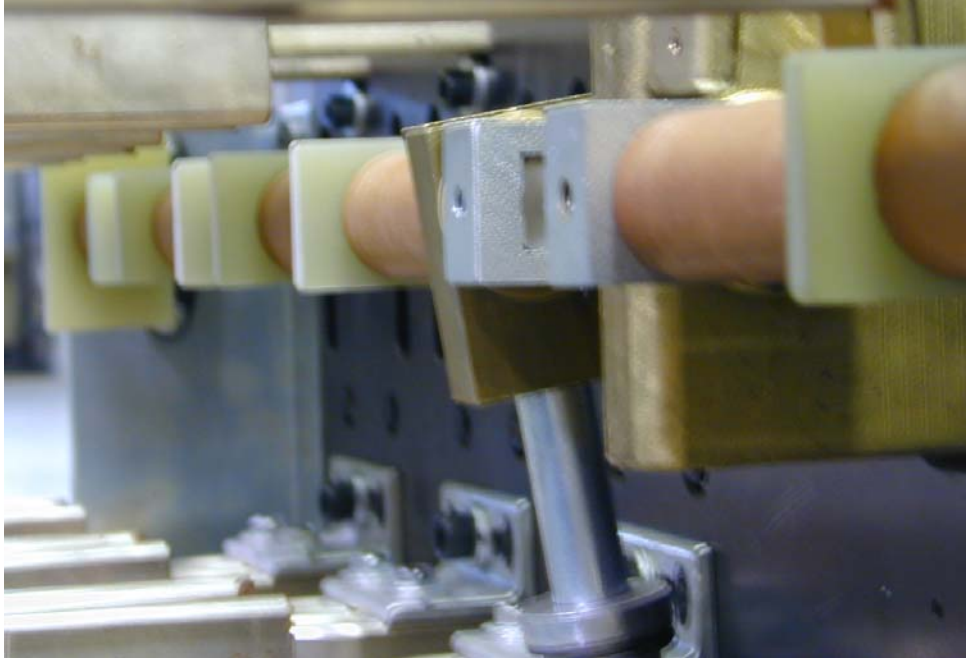


Figure 11.

- 2) Check to ensure that the micro switch is activated.

Note: You should hear the micro switch click, to activate.

If the micro switch is:	Then:
Activated	Continue on.
Not activated	Adjust the micro switch bracket until the switch is activated. Go to step 47.

- 3) Throw the ATS into over toggle.

GE ZENITH Controls

4) Check to ensure the micro switch is not bottomed out.

Note: You should have a small amount of play in the switch.

If the micro switch is:	Then:
Not bottomed out	Continue on.
Bottomed out	Adjust the micro switch bracket until the switch has slight play. Go to step 47.



Figure 12.

5) Place the switch into the open position.

GE ZENITH Controls

6) Check to ensure that the switch is activated, but not bottomed out.

Note: You should hear the micro switch click, to activate, but still have some free play in it.

If the micro switch is:	Then:
Activated and not bottomed out	Continue on.
Not activated or bottomed out	Adjust the micro switch bracket until the switch is activated. Go to step 47.



Figure 13.

48. Torque the remaining solenoid bolts to 25 ft-lbs.

49. Tie wrap the harness.

50. Replace the solenoid operating plate.

GE ZENITH Controls

51. Install the ATS in the cabinet.

- 1) Open the lower cabinet door.
- 2) Roll ATS back into the cabinet.
- 3) Slide the four corner latches, on the ATS, to the outermost position.
- 4) Place the DS into inhibit.
- 5) Manually position the ATS into the same position as the Bypass.
- 6) Reconnect the multi-pin plugs to the ATS.
- 7) Reconnect the External connections to the ATS.

52. Test the ATS.

- 1) Rotate the crank mechanism clockwise until the ATS test light is illuminated.

Note: The ATS location pointer will also indicate when the ATS is in test.

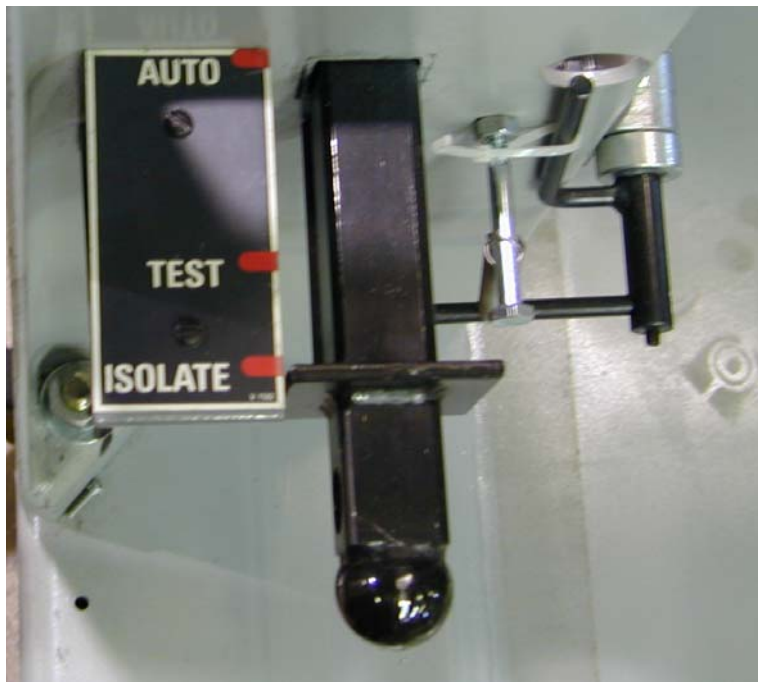


Figure 14.

- 2) Turn the DS to Auto.
- 3) Test the ATS electrically three times, with the Test Switch.

53. Reconnect the ATS.

54 Turn the DS to inhibit.

GE ZENITH Controls

55 Place the ATS is into the same position as the bypass.

56 Rotate the crank mechanism clockwise until the ATS location pointer is aligned with the "Auto" mark.

57 Turn the DS to Auto.

58 Open the Bypass with the MBH.

54. Close the lower cabinet door.

55. *Clean-up* the area.

56. *Complete* the Service Report.

57. *Send* Reports to GE Zenith Controls.

You know you are completed when:

The transfer switch is secured and operating properly.

The tools are stored.

The reports are completed.